


# Firmware update

## MODECOM FREEWAY MX


If you run MX FREEWAY device in service mode and after leaving it boot (starting) sequence stops at the logo image, make the firmware update by following steps:




1. Insert the SD card slot device with the previously downloaded firmware files (YFAPP.wzp, os82c.img, Logo82c.bmp).
2. Plug the AC charger.
3. Push power button for a moment.

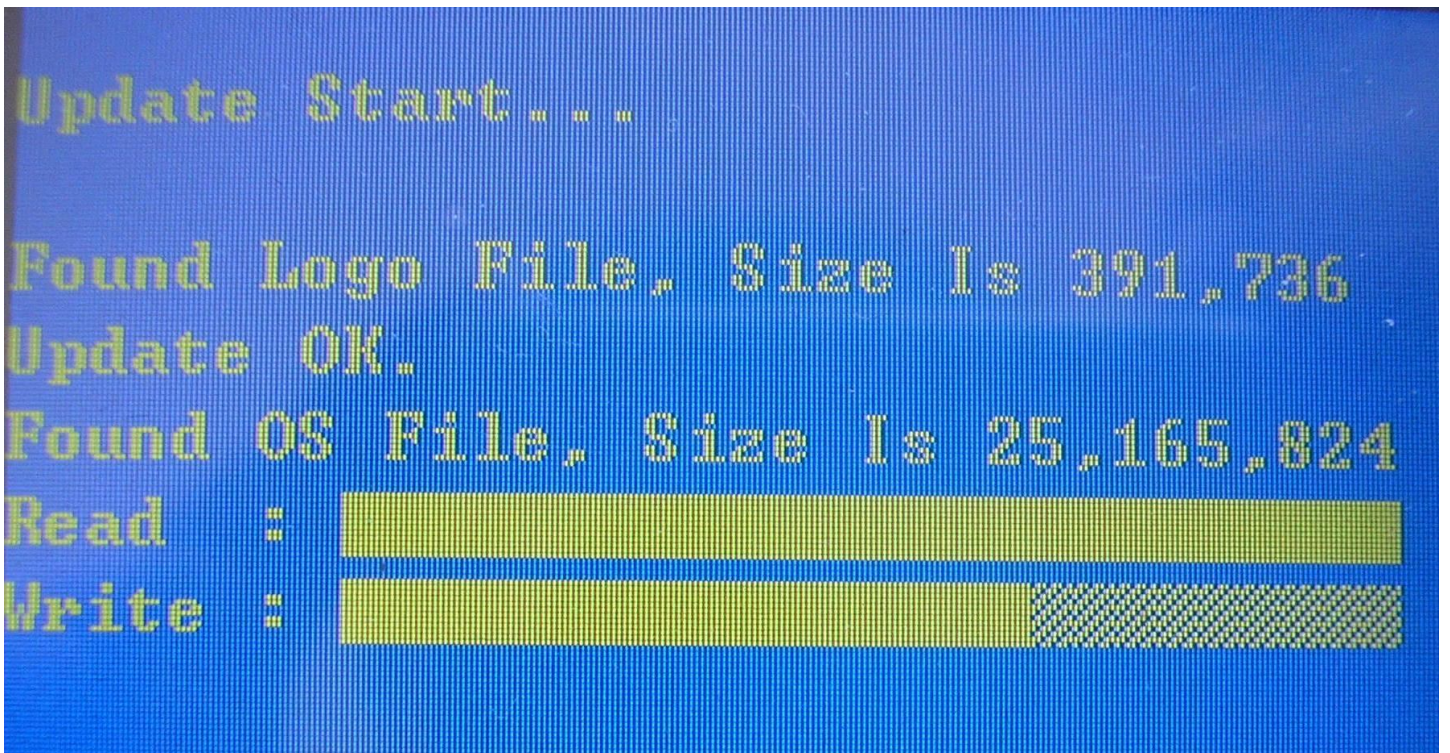


4. Wait for the process.

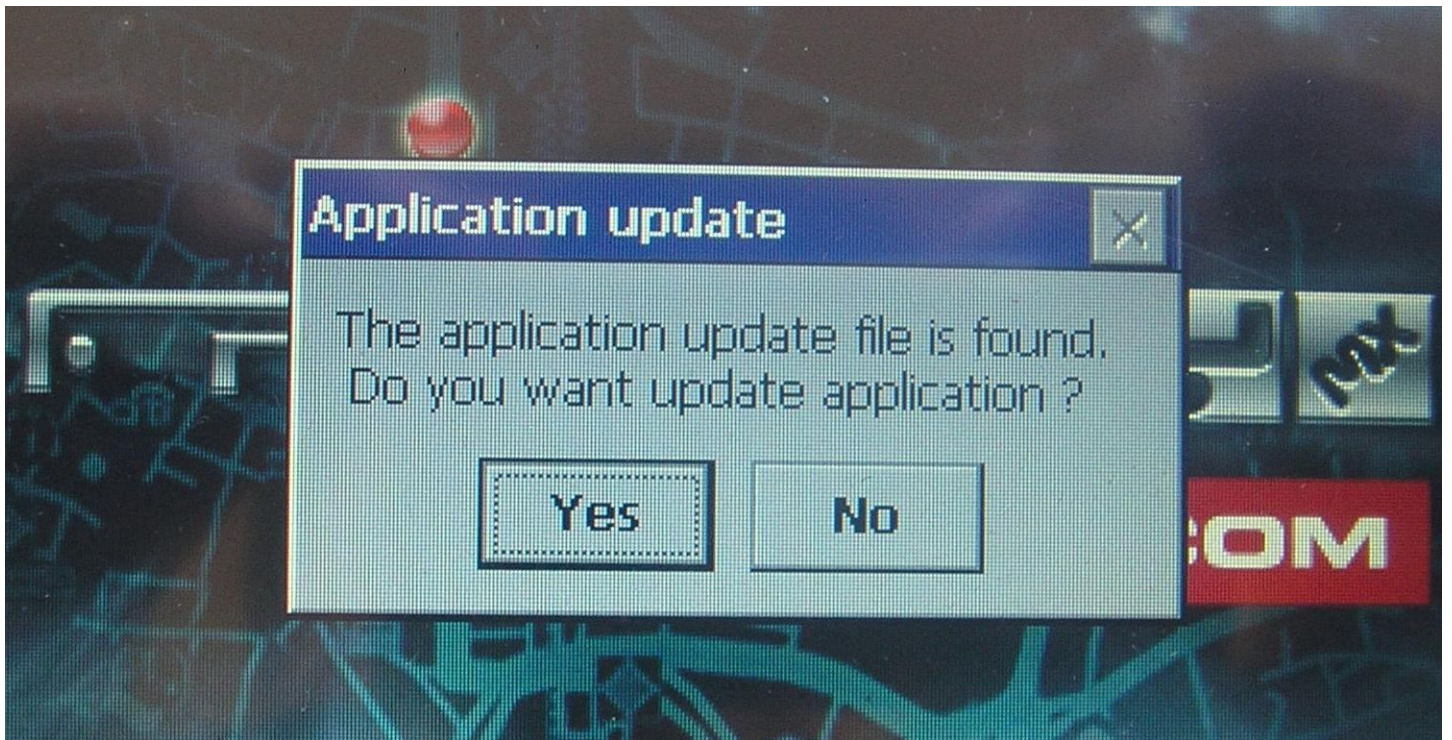

5. Confirm (YES) to start the process of updating firmware

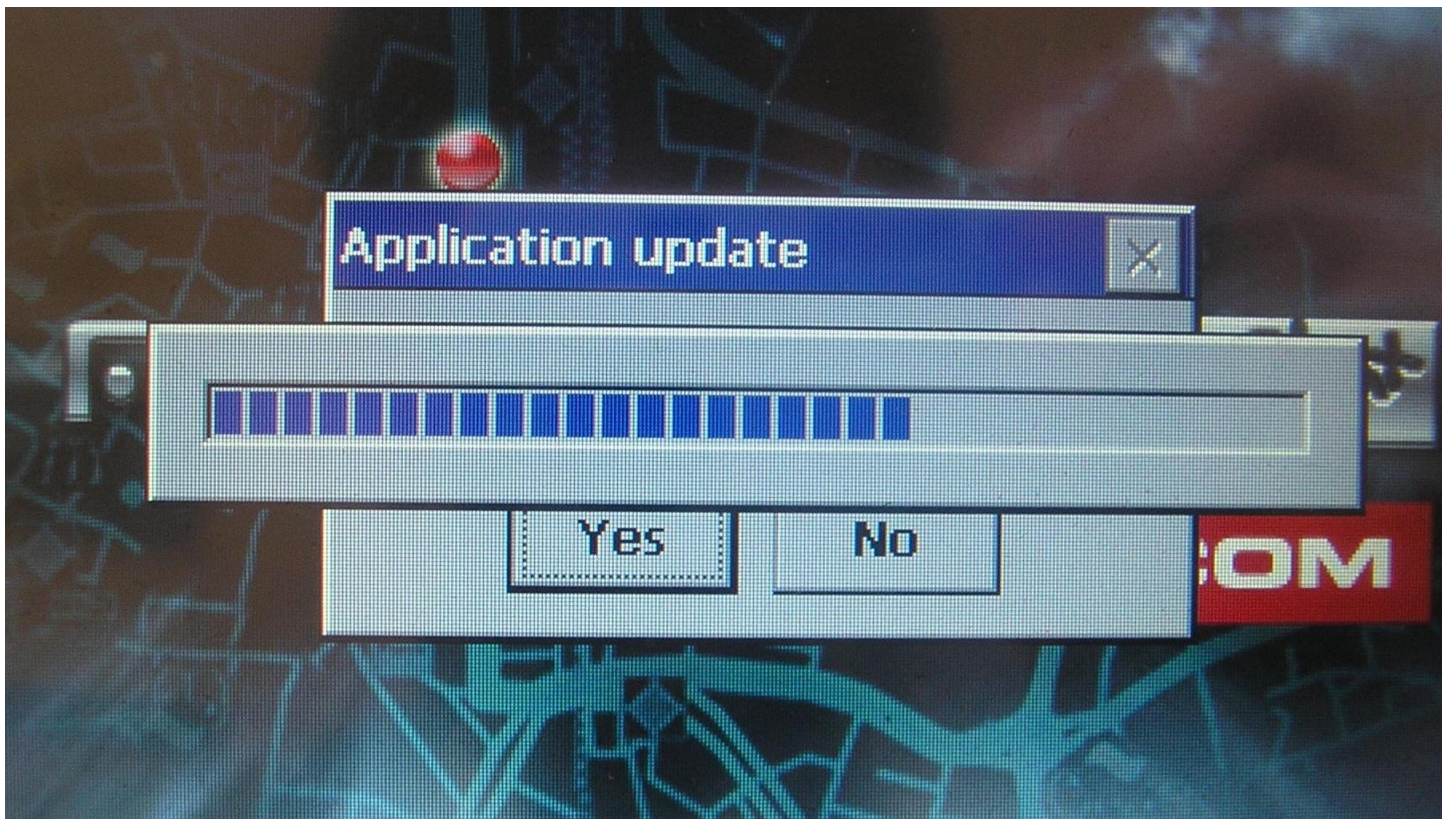

6. Wait for the process

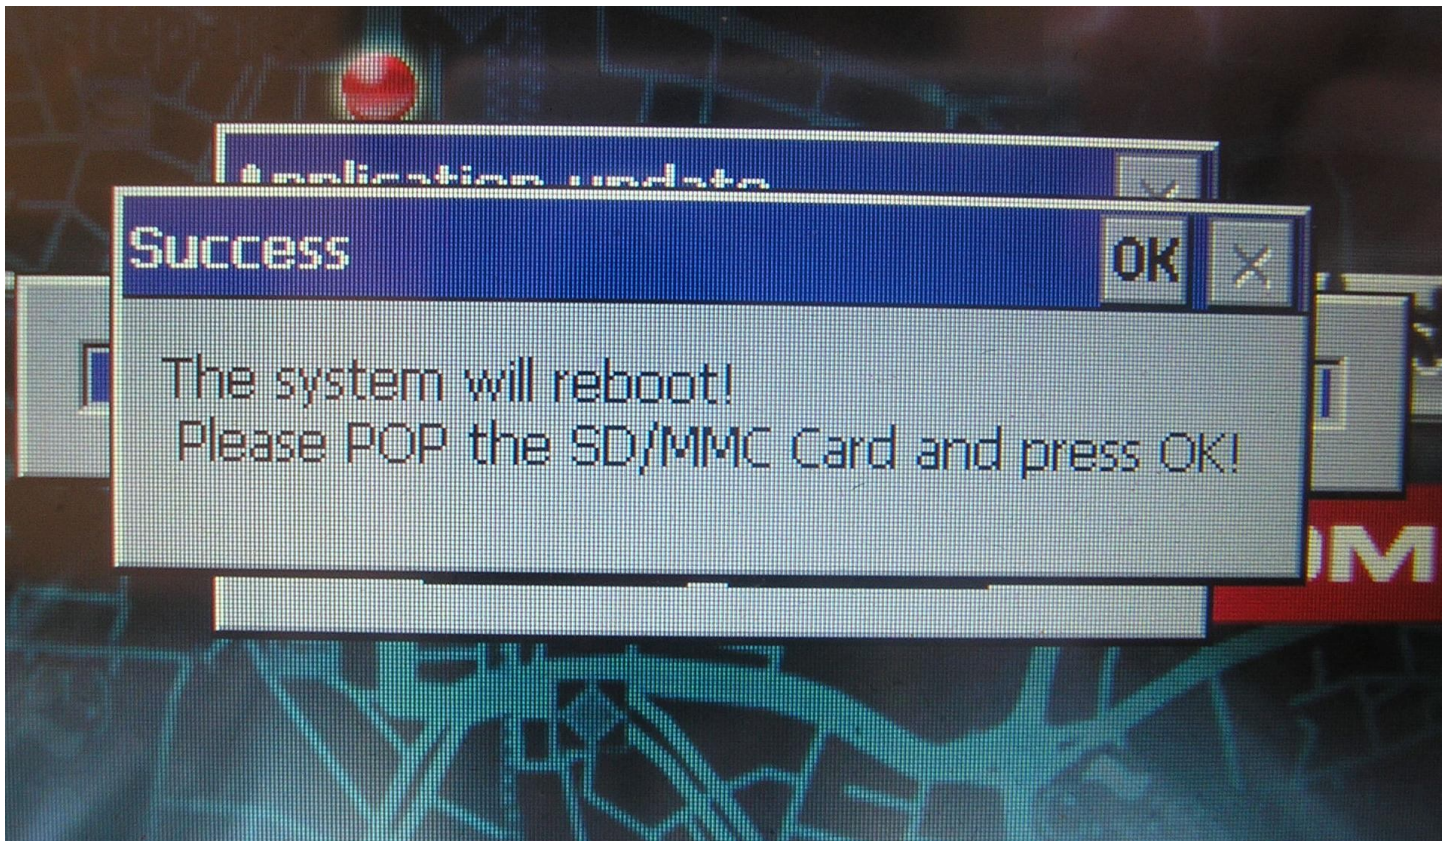

7. Remove SD card from device
8. Press OK button.