MODECOM FREETAB 2096 + / 4GB BLACK

Firmware updates >>> Android 4.1.1 Jelly Bean >>> Version 1

- Before updating charge the tablet
- Updates erases all data from the device
- Please carry out updating proces in accordance
- To run an update computer and micro usb connector (included) are required

The first launch of the device after the update may take a little longer than normally (a few minutes), as it is connected with the installation of the components.


- 1. Prepare tablet and micro usb cable which is included in the set
- 2. From the following link download the file containing updated to Android 4.1.1 Version 1

http://freetab.eu/softy/ENG/Tablets/FreeTAB 2096 PLUS/Firmware/Black Front/4GB/Android 4.1.1/Version 1/EN/Firmware 2096 android 4.1.1 version 1.zip

- **3.** Unzip the file **Firmware_2096_android_4.1.1_version_1.zip** on computer disk drive, a folder named Firmware_2096_android_4.1.1_version_1 will be created
- 4. Run the file RKBatchTool.exe from RKBatchTool_v1.7 folder

Rockchip Batch Tool v1.7			
Firmware: FW Ver: BOOT Ver:	FW Time: BOOT Time:	Support Chip:	File
MODECOM FreeTAB	2	3	4
5	6	7	8
Language Upgrade	Restore	Switch Clear	Save Exit

5. Turn off the tablet and connect it to the computer using usb cable, then press and hold V+ and Power buttons, next press the Reset button and keep still about 5 seconds down the V+ and Power, tablet will be detected by the system (the drivers will not be added automatically by the system, please follow the description which is below the photo)

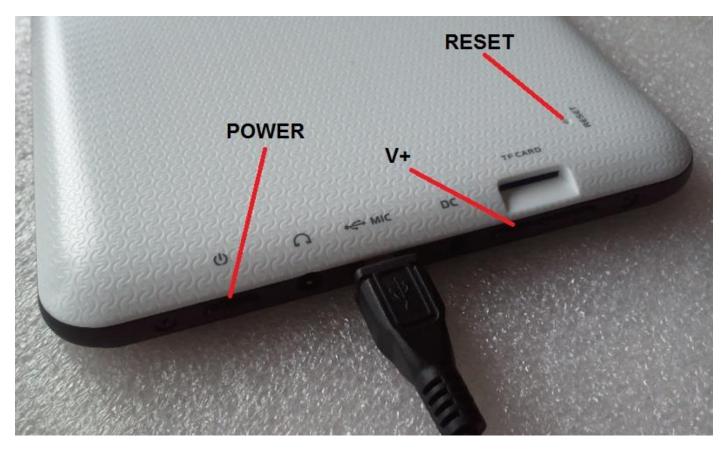

Use the drivers which are located in **RKBatchTool_v1.7\Rockusb_v3.5\Rockusb** folder. Drivers can be added to the system using the Device Manager System (Control Panel > Device Manager) or (Computer > Properties > Device Manager)


computer23 Baterie
Inne urządzenia
Nieznane urządzenie
a 📲 Karty graficzne
NVIDIA GeForce 310M
Karty sieciowe
📲 Broadcom 802.11n Network Adapter
📲 Karta wirtualnego miniportu WiFi firmy Microsoft
📲 Marvell Yukon 88E8059 Family PCI-E Gigabit Ethernet Controller
🛶 👰 Urządzenie Bluetooth (Protokół TDI RFCOMM)
🛄 Urządzenie Bluetooth (sieć osobista)
Klawiatury
Image: A state of the state
Kontrolery dźwięku, wideo i gier
👂 🥁 Kontrolery IDE ATA/ATAPI
🔈 🚽 Kontrolery uniwersalnej magistrali szeregowej
Monitory
Mysz i inne urządzenia wskazujące
Odbiorniki radiowe Bluetooth
Porty (COM i LPT)
Procesory
Stacje dysków
Stacje dysków CD-ROM/DVD
Irządzenia do obrazowania
Urządzenia interfejsu HID
⊳ -{IIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIII


🚔 computer23	
Baterie	
🛯 🖓 Inne urządzenia	
🦾 Nieznane urządzenia	A latura limiti a mana mana manina ata mana ilan
a 📲 Karty graficzne	Aktualizuj oprogramowanie sterownika
	Wyłącz
NVIDIA GeForce	Odinstaluj
Karty sieciowe	
👰 Broadcom 802.11	Skanuj w poszukiwaniu zmian sprzętu
🔤 Karta wirtualnegi	Właściwości
Marvell Yukon 88	
👰 Urządzenie Bluetooth	(Protokół TDI RFCOMM)
🔤 Urządzenie Bluetooth	(sieć osobista)
Klawiatury	
👂 🚛 Komputer	
🔉 📲 Kontrolery dźwięku, wideo	o i gier
👂 😋 Kontrolery IDE ATA/ATAP	T
👂 🏺 Kontrolery uniwersalnej m	nagistrali szeregowej
Monitory	
👂 🖞 Mysz i inne urządzenia ws	kazujące
Odbiorniki radiowe Blueto	ooth
Porty (COM i LPT)	
Procesory	
🔉 👝 Stacje dysków	
Stacje dysków CD-ROM/E)VD
🖟 🔚 Urządzenia do obrazowan	ia
🔉 🚛 Urządzenia interfejsu HID	
Urządzenia systemowe	

⊿ 🚔 computer23	
> 🗃 Baterie	
a 🖉 Inne urządzenia	
Im Nieznane urządzenie	
	×
🖉 🗕 Kreator aktualizacji sterowników - Nieznane urządzenie	
W jaki sposób chcesz wyszukać oprogramowanie sterownika?	
Wyszukaj automatycznie zaktualizowane oprogramowanie sterownika System Windows wyszuka najnowsze oprogramowanie sterownika urządzenia na tym komputerze i w Internecie, jeśli tej opcji nie wyłączono w ustawieniach instalacji urządzenia.	
Przeglądaj mój komputer w poszukiwaniu oprogramowania sterownika Odszukaj i zainstaluj oprogramowanie sterownika ręcznie.	
	Anuluj

6. Location drivers:

RKBatchTool_v1.7\Rockusb_v3.5\Rockusb\x64\win7 (for Windows 7 64-bit) RKBatchTool_v1.7\Rockusb_v3.5\Rockusb\x64\win8 (for Windows 8 64-bit) RKBatchTool_v1.7\Rockusb_v3.5\Rockusb\x64\vista (for Windows Vista 64-bit) RKBatchTool_v1.7\Rockusb_v3.5\Rockusb\x86\win7 (for Windows 7 32-bit) RKBatchTool_v1.7\Rockusb_v3.5\Rockusb\x86\win8 (for Windows 8 32-bit) RKBatchTool_v1.7\Rockusb_v3.5\Rockusb\x86\vista (for Windows 8 32-bit)

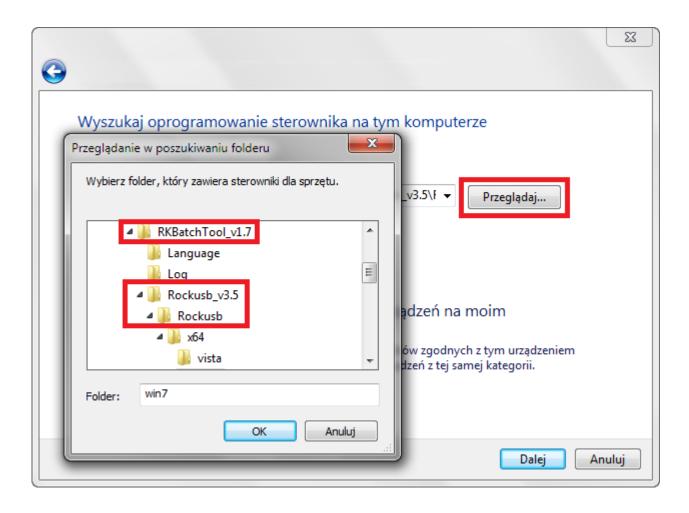

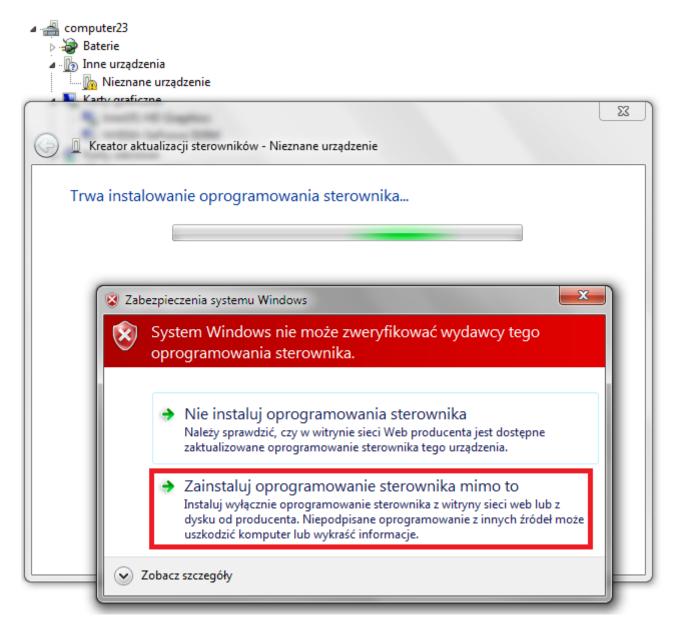

7. Driver has been added to the system, you can continue working with the program RKBatchTool

⊿ 🚔 computer23	
> 🗃 Baterie	
🖬 🕼 Inne urządzenia	
Real and the second sec	×
🕞 🗕 Kreator aktualizacji sterowników - RK30 Device	
System Windows pomyślnie zaktualizował oprogramowanie sterownika	
System Windows zakończył instalowanie oprogramowania sterownika dla tego urządzenia:	
RK30 Device	
Zarr	nknij

8. If the drivers were properly square 1 is green, click File and select the update file Firmware_2096_android_4.1.1_version_1.img in the folder Firmware_2096_android_4.1.1_version_1

Rockchip Batch Tool v1.7			
Firmware:			File
FW Ver: BOOT Ver:	FW Time: BOOT Time:	Support Chip:	
			· · · ·
MODECOM FreeTAB	2	3	4
2-1-1			
5	6	7	8
Language Upgrade	Restore	Switch Clear	Save Exit

Rockchip Batch Tool v1.7	
Firmware: FW Ver: BOOT Ver:	FW Time: Support Chip: BOOT Time:
	Dotwieranie Szukaj w: Die Firmware_MODEL_android_VERSIO - G p p p
	Nazwa Data modyfikacji Ty RKBatchTool v1.7 2013-08-05 11:29 Fc Firmware_MODEL_android_VERSION 2013-07-26 15:29 PI
MODECOM FreeT/ 1 2-1-1	✓ III Nazwa pliku: Otwórz Pliki typu: Fimware(*.img)
5	6 7 8
Language Upg	grade Restore Switch Clear Save Exit

9. Click **Upgrade**, the program will start upgrade procedure, wait a few minutes, do not unplug device from your computer during the update process, operation takes a few minutes

🌄 Rockchip Bat	tch Tool v1.7					- 0 X
Firmware:	<pre>C:\Firmware_MODEL_android_VERSION\Firmware_MODEL_android_VERSION.img</pre>					File
FW Ver:	4.2.02	FW Time:	2013-07-26 15:29:15	Support Chip:	RK31	
BOOT Ver:	1.24	BOOT Time:	2013-06-21 16:59:45			
Loading firm Loading firm	ware ware Finished.					
	OM FreeTAB 1 2-1-1	2		3	4	
	5	6		7	8	
Language	Upgrade	Restore	Switch	Clear	Save	Exit

🕞 Rockchip Bat	ch Tool v1.7					
Firmware:	C:\Firmware_MOD	EL_android_VERSI	ON\Firmware_MODEL_and	roid_VERSION.img		File
FW Ver:	4.2.02	FW Time:	2013-07-26 15:29:15	Support Chip:	RK31	
BOOT Ver:	1.24	BOOT Time:	2013-06-21 16:59:45			
(Layer 2-1-1) (Layer 2-1-1) (Layer 2-1-1) (Layer 2-1-1) (Layer 2-1-1) (Layer 2-1-1) (Layer 2-1-1) (Layer 2-1-1) (Layer 2-1-1) (Layer 2-1-1)	 Get FlashInfo S Prepare IDB State Prepare IDB Succession Download IDB State Download IDB State Reset Device State Wait For Loader Wait For Loader Test Device State Test Device State Download Firmwat 	rt cess art ccess art ccess Start Success rt				
MODEC	OM FreeTAB	2		3	4	
Downlo	ad (84%)					
	5	6		7	8	
Language	Upgrade	Restore	Switch	Clear	Save	Exit

Rockchip Bat	ch Tool v1.7					 X	
Firmware:	C:\Firmware_MODEL_android_VERSION\Firmware_MODEL_android_VERSION.img						
FW Ver:	4.2.02	FW Time:	2013-07-26 15:29:15	Support Chip:	RK31		
BOOT Ver:	1.24	BOOT Time:	2013-06-21 16:59:45				
<pre>(Layer 2-1-1) Reset Device Success (Layer 2-1-1) Wait For Loader Start (Layer 2-1-1) Wait For Loader Success (Layer 2-1-1) Test Device Start (Layer 2-1-1) Test Device Success (Layer 2-1-1) Download Firmware Start (Layer 2-1-1) Download Firmware Success (Layer 2-1-1) Reset Device Start (Layer 2-1-1) Reset Device Start (Layer 2-1-1) Reset Device Success ***********Upgrade Done Success(1) Fail(0) Time(113257)ms************************************</pre>							
MODEC	OM FreeTAB	2		3	4		
	5	6		7	8		
Language	Upgrade	Restore	Switch	Clear	Save	Exit	

The software has been properly installed, disconnect the device from the computer

