


MODECOM FREETAB 8001 IPS X2 3G

Firmware updates >>> Android 4.1.1 Jelly Bean >>> **Version 4**

- Before updating charge the tablet
- Updates erases all data from the device
- Please carry out updating proces in accordance
- To run an update computer and micro usb connector (included) are required


The first launch of the device after the update may take a little longer than normally (a few minutes), as it is connected with the installation of the components.


1. Prepare tablet and micro usb cable which is included in the set
2. From the following link download the file containing updated to Android 4.1.1 Version 4
http://freetab.eu/softy/ENG/Tablets/FreeTAB_8001_IPS_X2_3G/Firmware/Android_4.1.1/Version_4/EN/Firmware_8001_android_4.1.1_version_4.zip
3. Unzip the file **Firmware_8001_android_4.1.1_version_4.zip** on computer disk drive, a folder named Firmware_8001_android_4.1.1_version_4 will be created
4. Run the file **RKBatchTool.exe** from **RKBatchTool_v1.7** folder

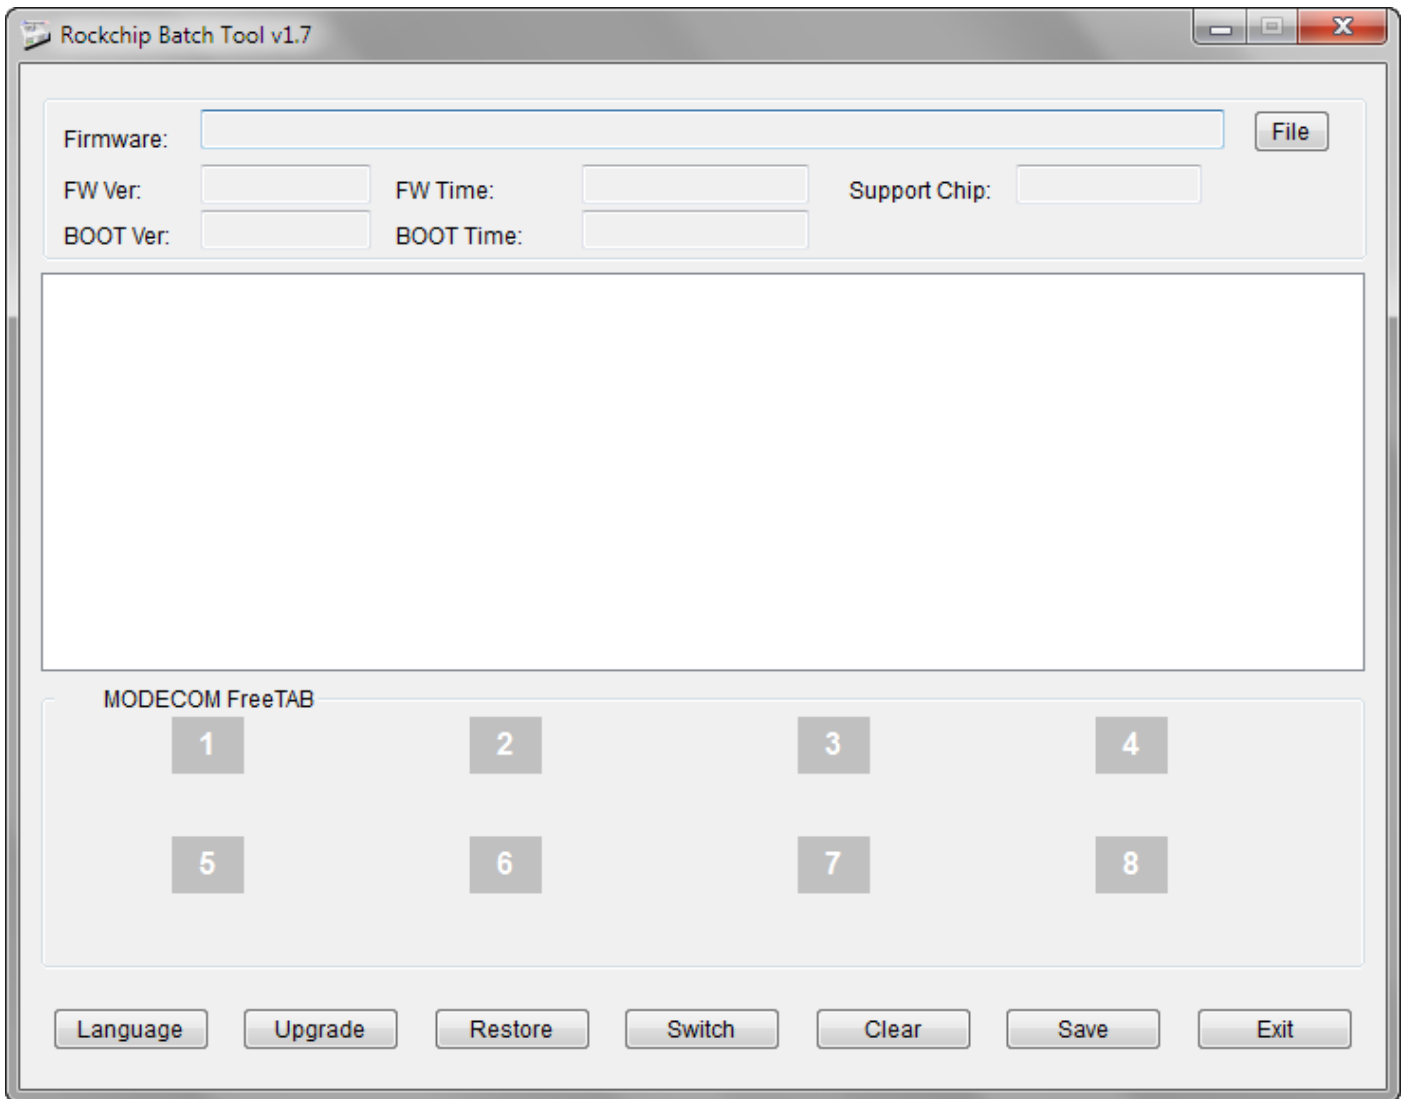

5. Turn off the tablet and connect it to the computer using usb cable, then **press and hold V+** button, next press the **Reset** button and keep still about 5 seconds down the **V+**, tablet will be detected by the system (the drivers will not be added automatically by the system, please follow the description which is below the photo)

Use the drivers which are located in **RKBatchTool_v1.7\Rockusb_v3.5\Rockusb** folder. Drivers can be added to the system using the Device Manager System (Control Panel > Device Manager) or (Computer > Properties > Device Manager)

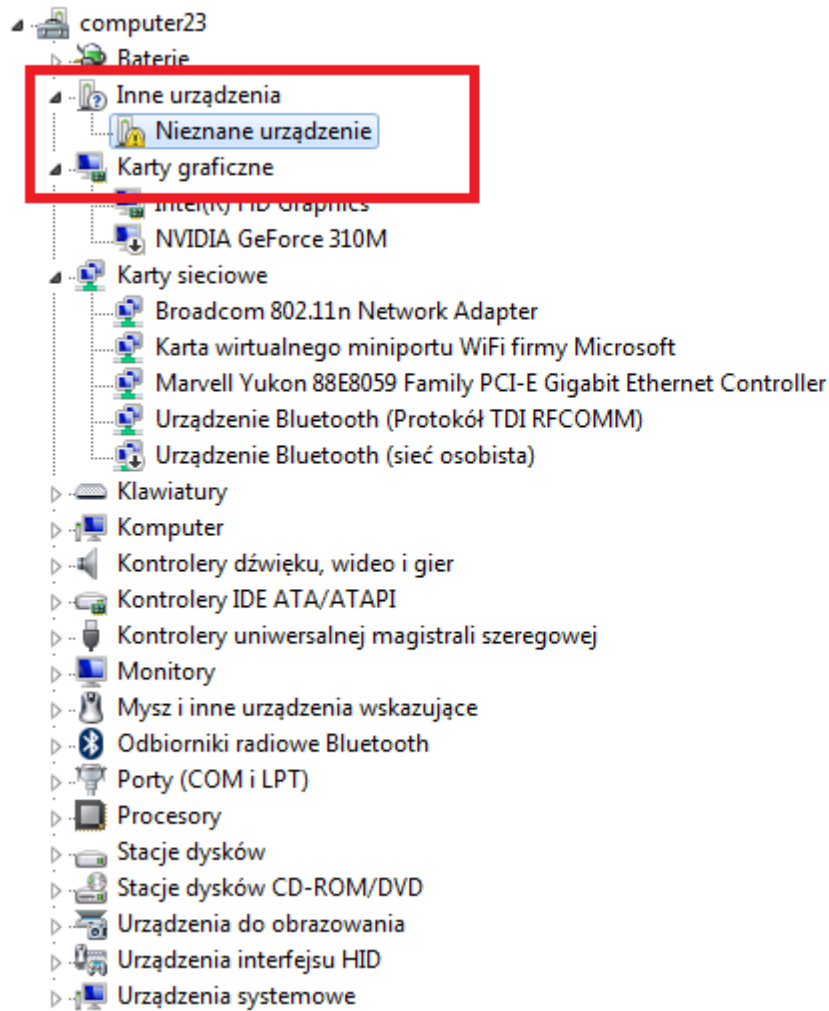


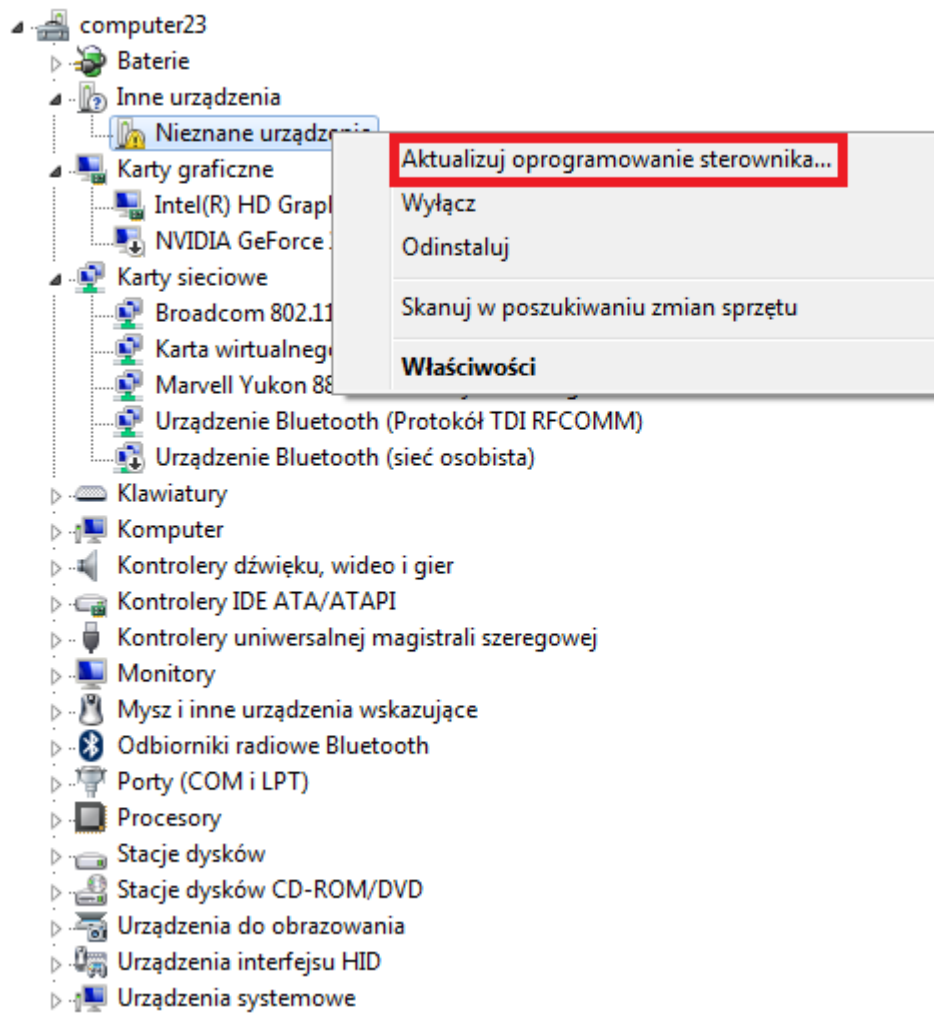





6. Location drivers:

RKBatchTool_v1.7\Rockusb_v3.5\Rockusb\x64\win7 (for **Windows 7** 64-bit)
RKBatchTool_v1.7\Rockusb_v3.5\Rockusb\x64\win8 (for **Windows 8** 64-bit)
RKBatchTool_v1.7\Rockusb_v3.5\Rockusb\x64\vista (for **Windows Vista** 64-bit)
RKBatchTool_v1.7\Rockusb_v3.5\Rockusb\x86\win7 (for **Windows 7** 32-bit)
RKBatchTool_v1.7\Rockusb_v3.5\Rockusb\x86\win8 (for **Windows 8** 32-bit)
RKBatchTool_v1.7\Rockusb_v3.5\Rockusb\x86\vista (for **Windows Vista** 32-bit)

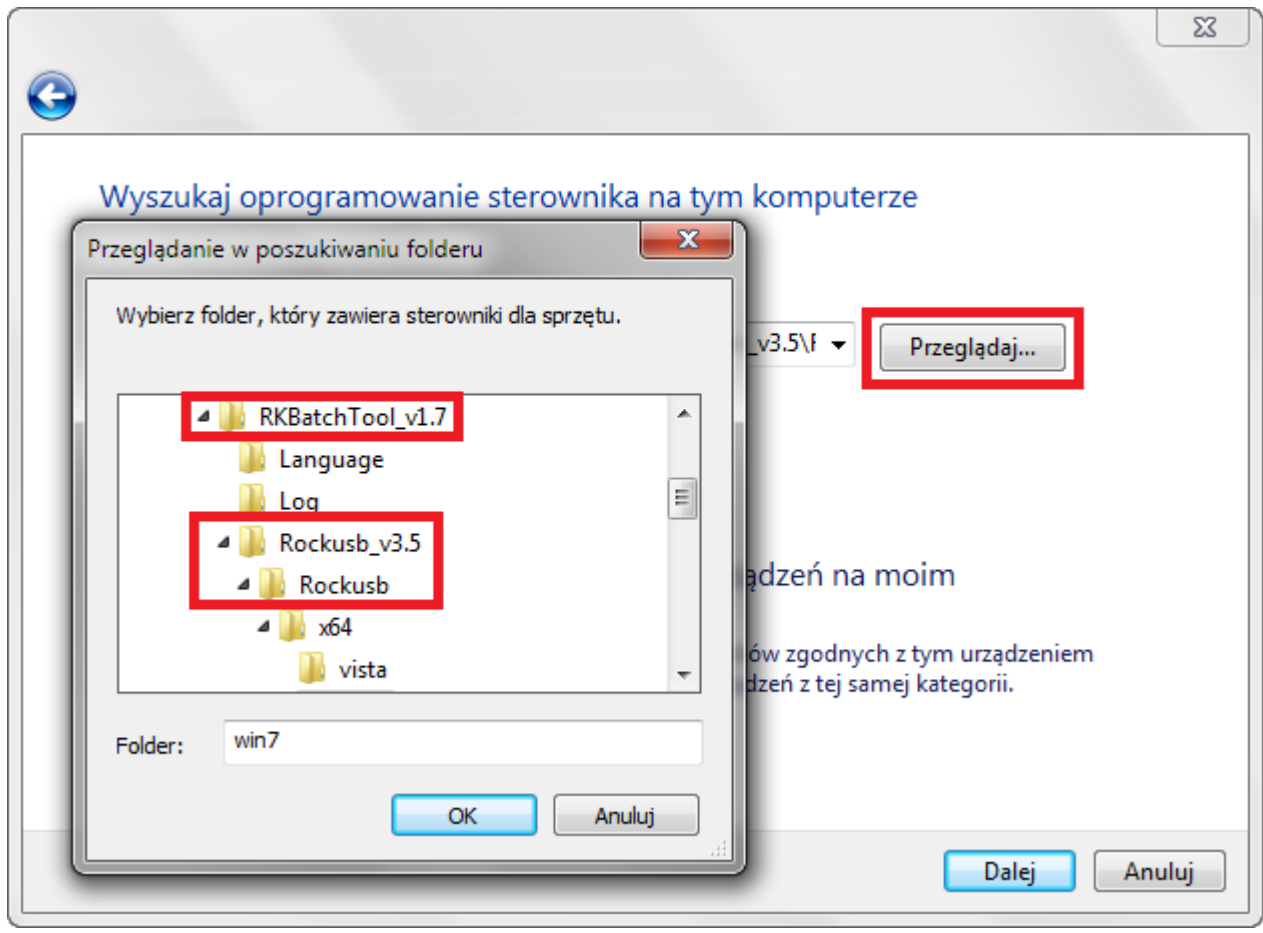

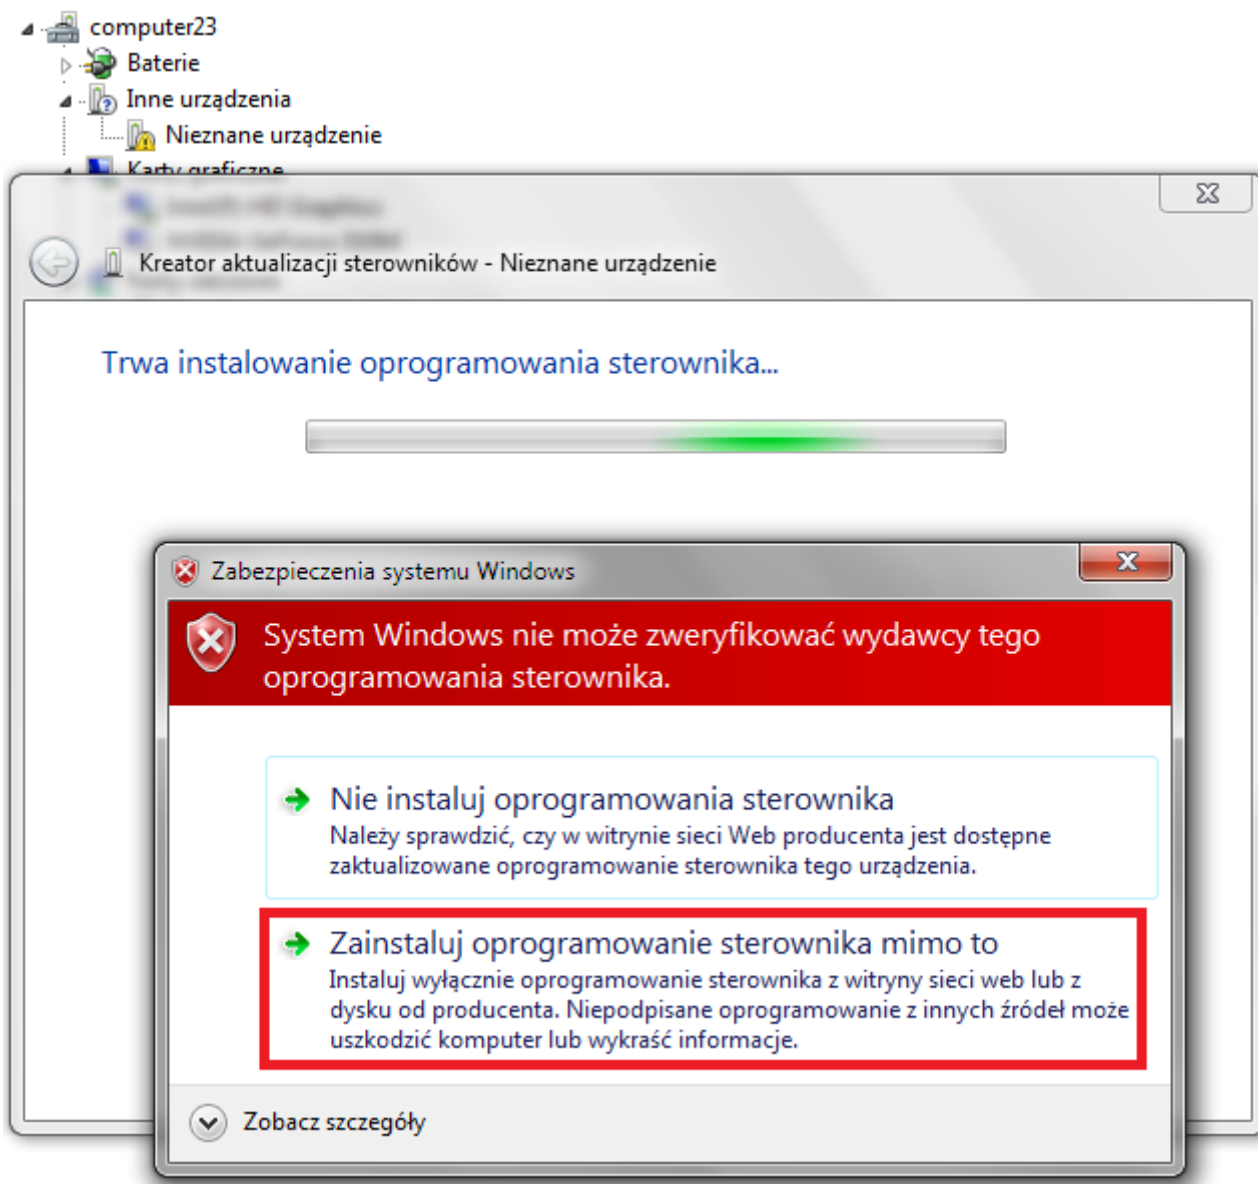

7. Driver has been added to the system, you can continue working with the program **RKBatchTool**

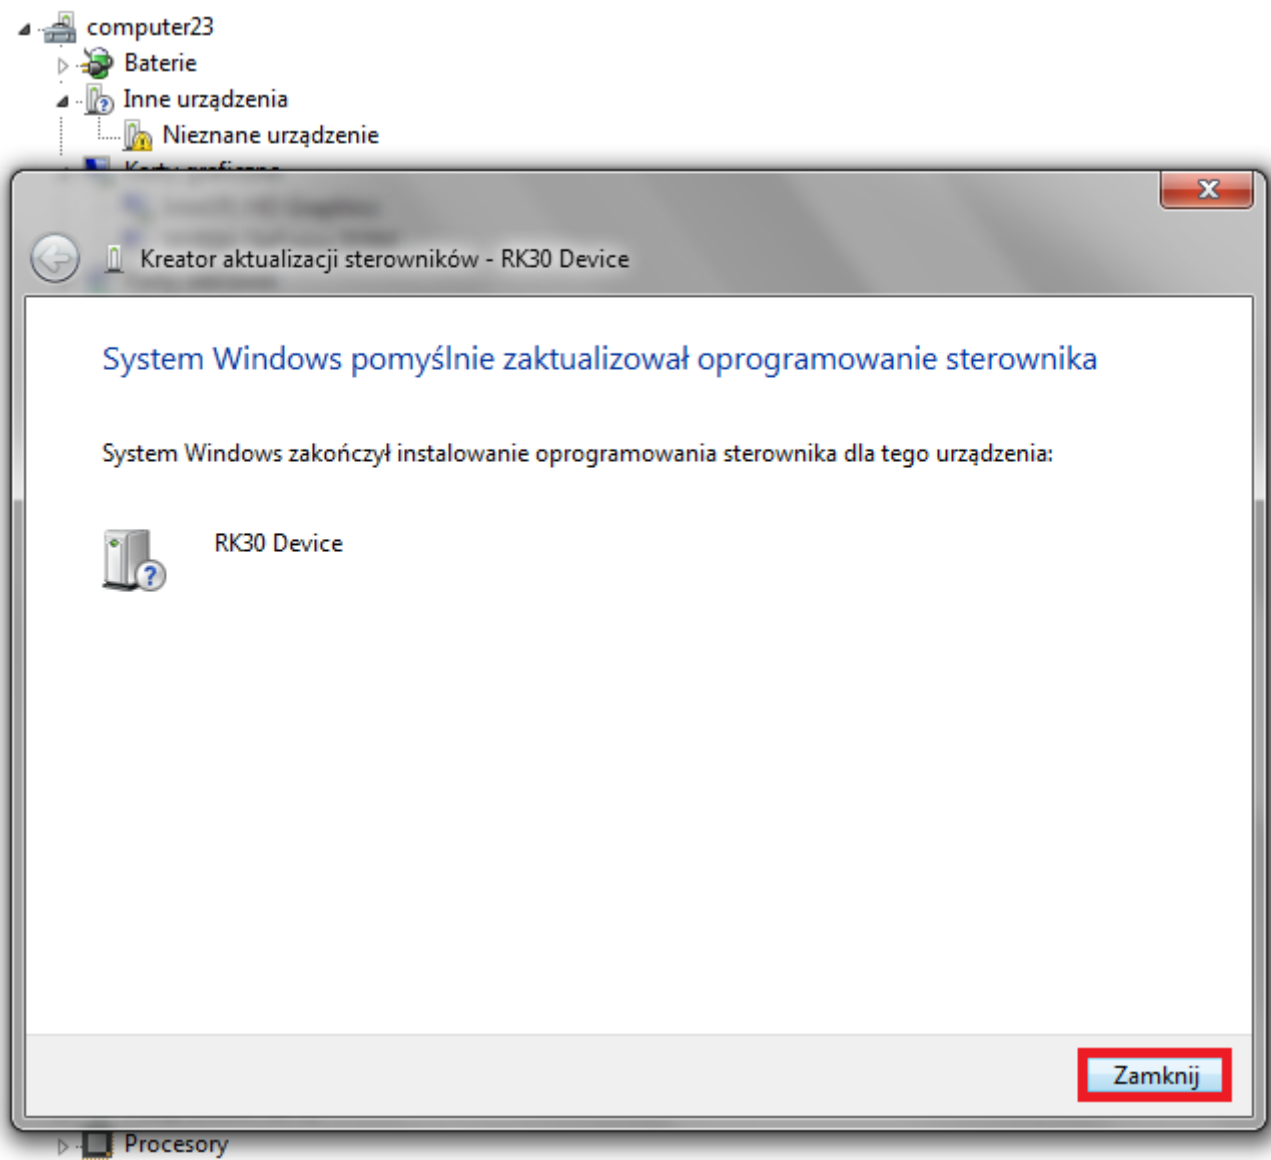

8. If the drivers were properly square 1 is green, click **File** and select the update file **Firmware_8001_android_4.1.1_version_4.img** in the folder **Firmware_8001_android_4.1.1_version_4**

Firmware:

File

FW Ver:

FW Time:

Support Chip:

BOOT Ver:

BOOT Time:



MODECOM FreeTAB

1

2

3

4

2-1-1

5

6

7

8

Language

Upgrade


Restore

Switch

Clear

Save

Exit

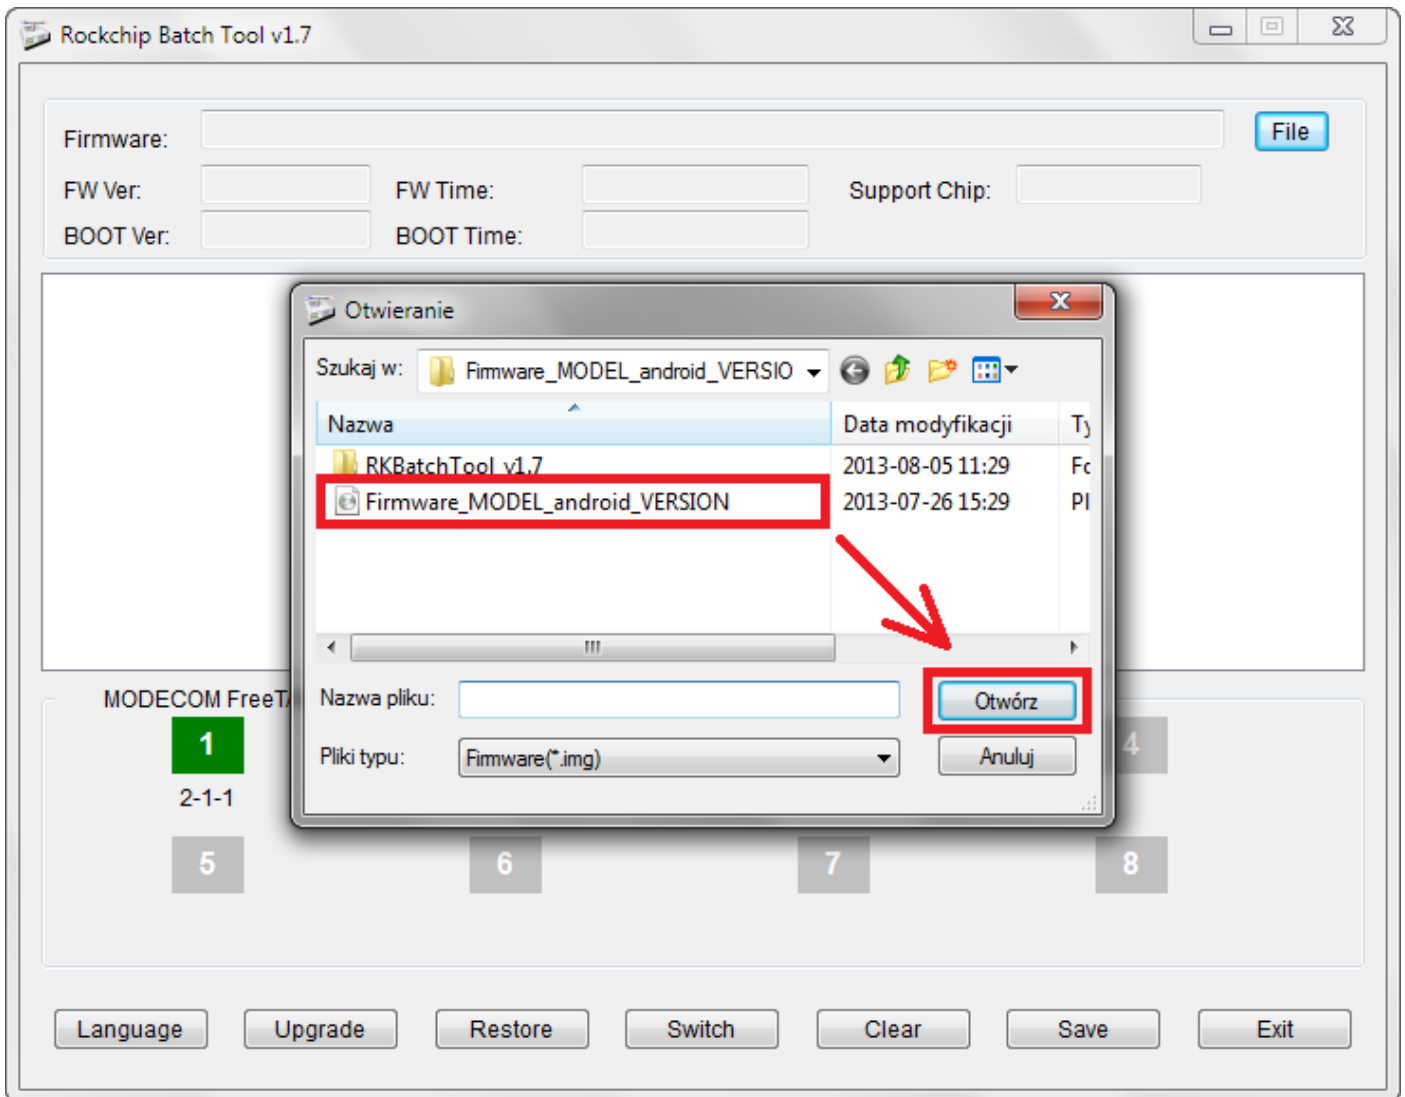

9. Click **Upgrade**, the program will start upgrade procedure, wait a few minutes, do not unplug device from your computer during the update process, operation takes a few minutes

Rockchip Batch Tool v1.7

Firmware: C:\Firmware_MODEL_android_VERSION\Firmware_MODEL_android_VERSION.img

File

FW Ver: 4.2.02

FW Time: 2013-07-26 15:29:15

Support Chip: RK31

BOOT Ver: 1.24

BOOT Time: 2013-06-21 16:59:45

Loading firmware...
Loading firmware Finished.

MODECOM FreeTAB

1

2-1-1

2

3

4

5

6

7

8



Language

Upgrade

Restore

Switch

Clear

Save

Exit

Firmware:


FW Ver: FW Time: Support Chip:

BOOT Ver: BOOT Time:

```
<Layer 2-1-1> Get FlashInfo Success
<Layer 2-1-1> Prepare IDB Start
<Layer 2-1-1> Prepare IDB Success
<Layer 2-1-1> Download IDB Start
<Layer 2-1-1> Download IDB Success
<Layer 2-1-1> Reset Device Start
<Layer 2-1-1> Reset Device Success
<Layer 2-1-1> Wait For Loader Start
<Layer 2-1-1> Wait For Loader Success
<Layer 2-1-1> Test Device Start
<Layer 2-1-1> Test Device Success
<Layer 2-1-1> Download Firmware Start
```

MODECOM FreeTAB

1	2	3	4
Download (84%)...			
5	6	7	8

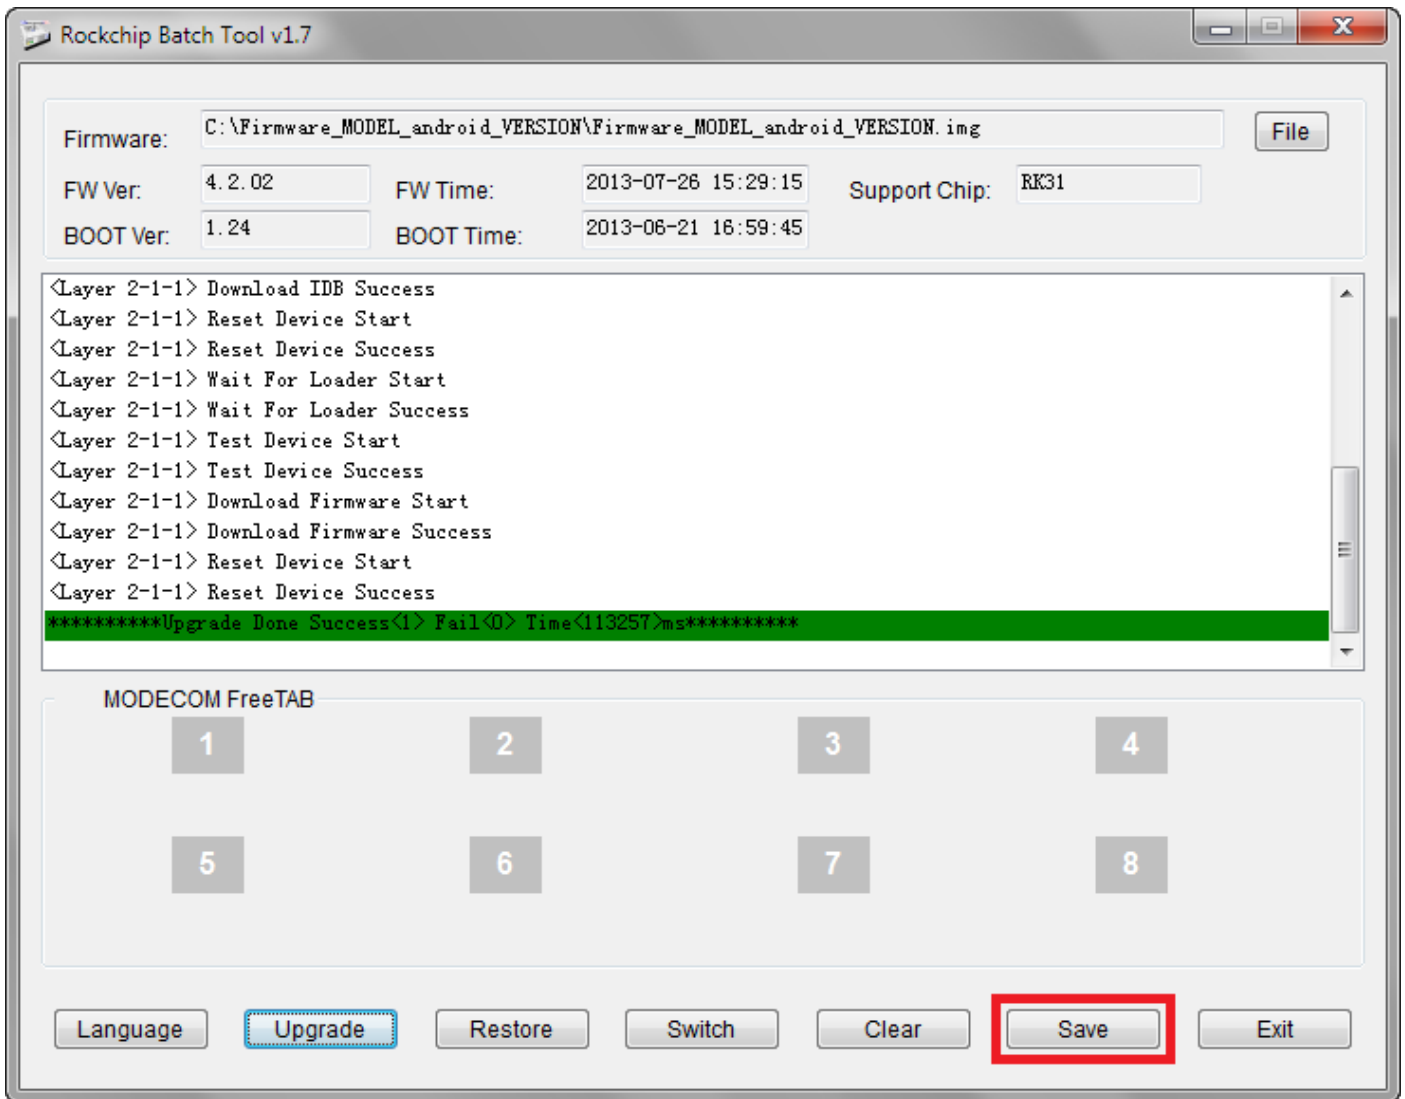

The software has been properly installed, disconnect the device from the computer

